DI384-04

DTC		Insufficient Coolant Temp. for Closed Loop Fuel Control
-----	--	---

CIRCUIT DESCRIPTION


To obtain a high purification rate for the CO, HC and NOx components of the exhaust gas, a three–way catalytic converter is used, but for the most efficient use of the three–way catalytic converter, the air–fuel ratio must be precisely controlled so that it is always close to the stoichiometric air–fuel ratio.

The heated oxygen sensor (bank 1, 2 sensor 1) has the characteristic and that output voltage, which changes suddenly in the vicinity of the stoichiometric air—fuel ratio. This is used to detect the oxygen concentration in the exhaust gas and provide the ECM with feedback to control the air—fuel ratio.

When the air–fuel ratio becomes LEAN, the oxygen concentration in the exhaust increases and the heated oxygen sensor informs the ECM of the LEAN condition (small electromotive force: < 0.45 V).

When the air–fuel ratio is RICHER than the stoichiometric air–fuel ratio the oxygen concentration in the exhaust gas in reduced and the heated oxygen sensor informs the ECM of the RICH condition (large electromotive force: > 0.45 V).

The ECM judges by the electromotive force from the heated oxygen sensor whether the air—fuel ratio is RICH or LEAN and controls the injection time accordingly. However, if malfunction of the heated oxygen sensor causes output of abnormal electromotive force, the ECM is unable to perform accurate air—fuel ratio control. The heated oxygen sensors include a heater which heats the zirconia element. The heater is controlled by the ECM. When the intake air volume is low (the temp. of the exhaust gas is low) current flows to the heater to heat the sensor for accurate oxygen concentration detection.

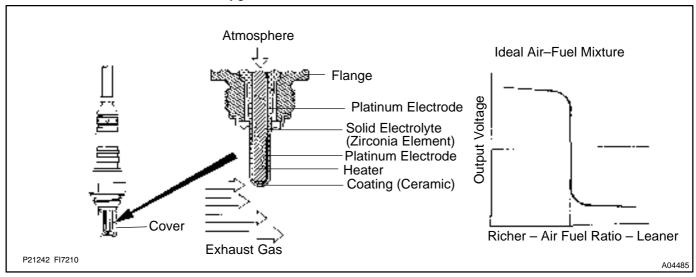

DTC No.	DTC Detection Condition	Trouble Area
P0125	After engine is warmed up, oxygen sensor (bank 1, 2 sensor 1) output does not indicate RICH (≥ 0.45 V) even once when conditions (a), (b), and (c) continue for at least 1.5 min.: (a) Engine speed: 1,400 rpm or more (b) Vehicle speed: 40 – 100 km/h (25 – 62 mph) (c) Throttle valve does not fully closed	Open or short in heated oxygen sensor (bank 1, 2 sensor 1) circuit Heated oxygen sensor (bank 1, 2 sensor 1) Air induction system Fuel system Injector Gas leakage on exhaust system ECM


2000 MR2 (RM760U)

HINT:

After confirming DTC P0125, use the OBD II scan tool or TOYOTA hand—held tester to confirm voltage output of the heated oxygen sensor (bank 1, 2 sensor 1) from the CURRENT DATA.

If the voltage output of the heated oxygen sensor (bank 1, 2 sensor 1) is less than 0.1 V, the heated oxygen sensor circuit may be open or short.


WIRING DIAGRAM

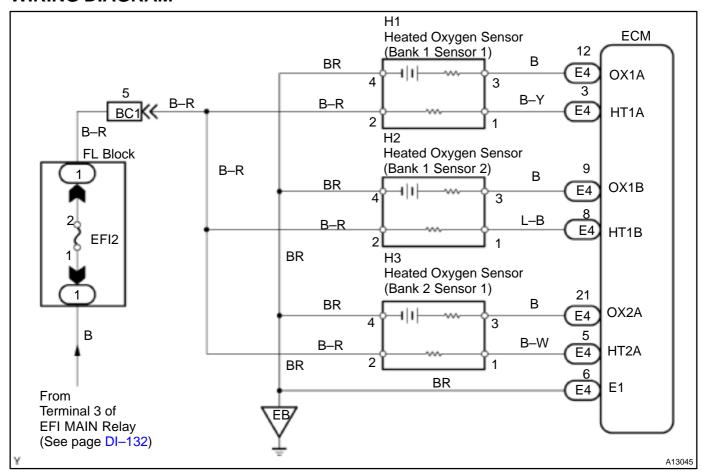

INSPECTION PROCEDURE

HINT:

 - If the vehicle runs out of fuel, the air–fuel ratio is LEAN and DTC P0125 will be recorded. The MIL then comes on.
- Read freeze frame data using TOYOTA hand-held tester or OBD II scan tool. Because freeze frame
 records the engine conditions when the malfunction is detected. When troubleshooting, it is useful for
 determining whether the vehicle was running or stopped, the engine was warmed up or not, the air-fuel
 ratio was lean or rich, etc. at the time of the malfunction.
 - 1 Are there any other codes (besides DTC P0125) being output ?



NO

2000 MR2 (RM760U)

2 Connect OBD II scan tool or TOYOTA hand-held tester and read value for voltage output of heated oxygen sensor (bank 1, 2 sensor 1).

PREPARATION:

- (a) Connect the OBD II scan tool or TOYOTA hand-held tester to the DLC3.
- (b) Warm up the engine to normal operating temperature (above 75°C).

CHECK:

Read the voltage output of the heated oxygen sensor when the engine is suddenly raced.

HINT:

Perform quick racing to 4,000 rpm for 3 times using the accelerator pedal.

OK:

Heated oxygen sensor outputs a RICH signal (0.45 V or more) at least once.

OK Go to step 9.

NG

Check for open and short in harness and connector between ECM and heated oxygen sensor (bank 1, 2 sensor 1) (See page IN-28).

NG

Repair or replace harness or connector.

ΟK

4 Check whether misfire has occurred or not by monitoring DTC and data list.

NG

Perform troubleshooting for misfire (See page DI-63).

OK

5 Check air induction system (See page SF-1).

NG

Repair or replace induction system.

ΟK

2000 MR2 (RM760U)

6	Check fuel pressure (See page SF-7).			
	· 			
		NG	Check and repair fuel pump, fuel pipe line and filter.	
	\neg			
ОК				
7	Check injector injection (See page SF-24).			
		[
		NG	Replace injector.	
OK				
OK				
8	Check gas leakage on exhaust	system	1.	
	Γ			
		NG	Repair or replace.	
	\neg			
OK				
Repla senso	ace heated oxygen sensor (bank 1	1, 2		
361130	Oi 1).			
9	Perform confirmation driving pa	attern (See page DI–47).	
	7			
Go				
10	Is there DTC P0125 being outpu	ut agair	1?	
	Γ			
		YES	Check and replace ECM (See page IN-18).	
NO				
2000 MR2	2 (RM760U)			

11 Did vehicle runs out of fuel in past?

NO

Check for intermittent problems (See page DI-3).

YES

DTC P0125 is caused by shortage of fuel.

2000 MR2 (RM760U)