| DTC | P0440 | Evaporative Emission Control System Malfunction |
|-----|-------|--|
|-----|-------|--|

CIRCUIT DESCRIPTION

The vapor pressure sensor, VSV for canister closed valve (CCV) and VSV for pressure switching valve are used to detect abnormalities in the evaporative emission control system.

The ECM decides whether there is an abnormality in the evaporative emission control system based on the vapor pressure sensor signal.

DTC P0440 is recorded by the ECM when evaporative emissions leak from the components within the dotted line in Fig. 1 below, or when the vapor pressure sensor malfunctions.



| DTC No. | DTC Detection Condition | Trouble Area |
|---------|--|--|
| P0440 | Fuel tank pressure is atmospheric pressure after vehicle is driven for 20 min. (2 trip detection logic) | Hose or tube cracked, holed, damaged or loose seal ((3) in Fig. 1) Fuel tank cap incorrectly installed Fuel tank cap cracked or damaged Vacuum hose cracked, holed, blocked, damaged or disconnected ((1) or (2) in Fig. 1) Fuel tank cracked, holed or damaged Charcoal canister cracked, holed or damaged Open or short in vapor pressure sensor circuit Vapor pressure sensor Fuel tank over fill check valve cracked or damaged ECM |

DI7DF-01

WIRING DIAGRAM



INSPECTION PROCEDURE

HINT:

- If DTC P0441, P0446, P0450 or P0451 is output after DTC P0440, first troubleshoot DTC P0441, P0446, P0450 or P0451. If no malfunction is detected, troubleshoot DTC P0440 next.
- Ask the customer whether, after the MIL came on, the customer found the fuel tank cap loose and tightened it. Also ask the customer whether the fuel tank cap was loose when refuelling. If the fuel tank cap was not loose, the DTC is suspected. If the fuel tank cap was not loose or if the customer was not sure if it was loose, troubleshoot according to the following procedure.
- Read freeze frame data using TOYOTA hand-held tester or OBD II scan tool. Because freeze frame
 records the engine conditions when the malfunction is detected. When troubleshooting, it is useful for
 determining whether the vehicle was running or stopped, the engine was warmed up or not, the air-fuel
 ratio was lean or rich, etc. at the time of the malfunction.
- When the ENGINE RUN TIME in the freeze frame data is less than 200 seconds, carefully check the VSV for EVAP, charcoal canister and vapor pressure sensor.

1

Check whether hose close to fuel tank have been modified, and check whether

there are signs of any accident near fuel tank or charcoal canister. **CHECK:** Check for cracks, deformation and loose connection of the following parts: Fuel tank • Charcoal canister Fuel tank filler pipe Hoses and tubes around fuel tank and charcoal canister NG Repair or replace. A10274 OK 2 Check that fuel tank cap is TOYOTA genuine parts. NG Replace with TOYOTA genuine parts. OK 3 Check that fuel tank cap is correctly installed. NG Correctly install fuel tank cap. OK 4 Check fuel tank cap (See page EC-6).





- (a) Check for proper connection of the fuel tank and fuel evap pipe (See page EC–6), fuel evap pipe and fuel tube under the floor, fuel tube under the floor and charcoal canister.
- (b) Check the hose and tube for cracks, hole and damage.



Author :

Date :



valve.

Date :

246

OK

It is likely that vehicle user did not properly close fuel tank cap. Please explain to customer how to properly install fuel tank cap.